

Certified, Filed and or Recorded on  
Oct. 07, 2008 AT 02:39PM

Signed: BW  
MARILYN J NOVAK  
BENTON COUNTY MINNESOTA  
MARILYN J NOVAK  
COUNTY RECORDER

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


NORTHEAST Corner of Section 26, Township 36N, Range 29W  
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

On 10/06/08 found a PK nail under bituminous on State Highway 95.

left monument as found       lowered monument       removed monument (explain)

On 10/06/08 placed an P.K. NAIL WITH BENTON COUNTY SURVEYOR DISK OVER  
monument, flush with surface

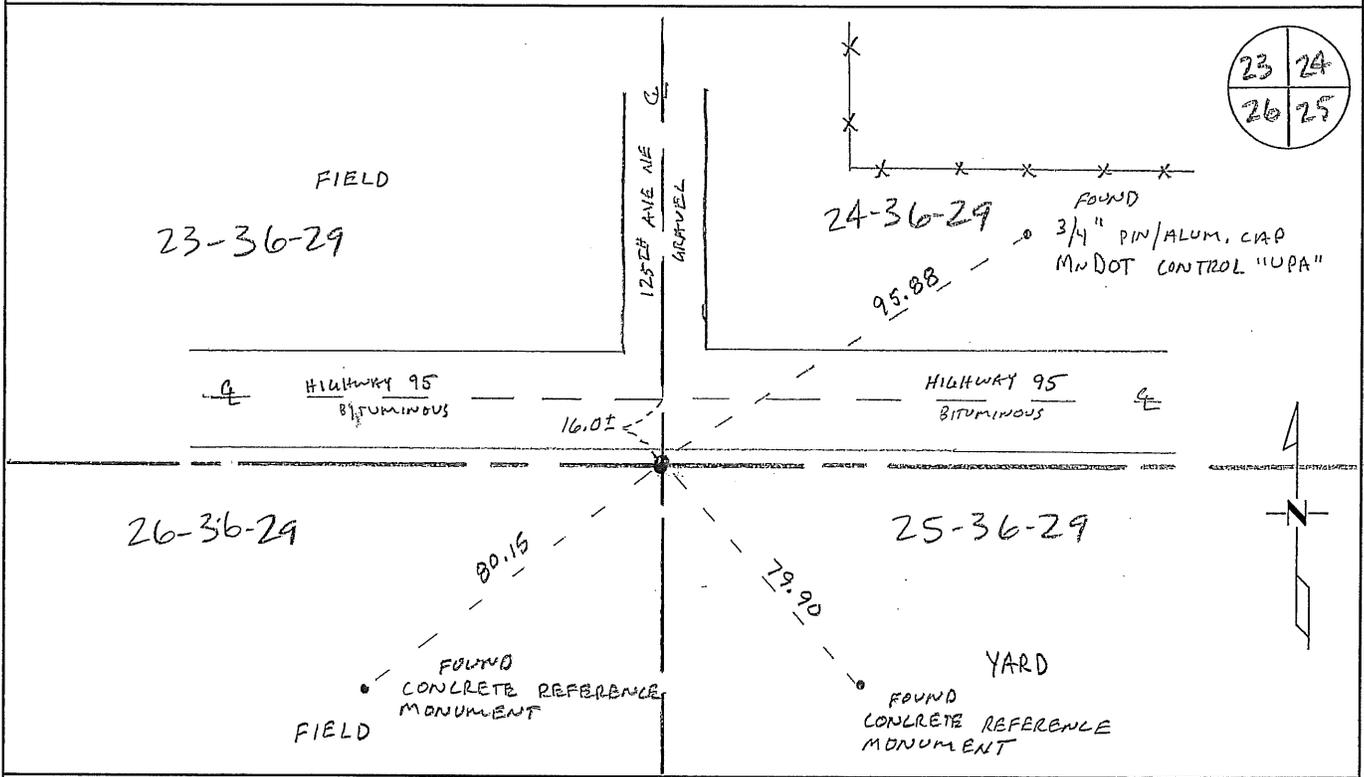

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature Jason W. Oley  
Deputy Benton County Surveyor  
License No. 45872

Date: 10/06/08

Benton County Surveyor's Office  
 Jason W. Oberg, Deputy County Surveyor  
 Minnesota License No. 45872

Statement of Evidence:

K262

The Northeast Corner of Section 26, Township 36 North, Range 29 West, St. George Township, 4<sup>th</sup> Principal Meridian, Benton County, Minnesota.

- 1855 Original US General Land Office survey established corner marked by a wood post with bearing trees:
- |            |          |           |
|------------|----------|-----------|
| 6" Bl. Oak | N 58 E   | 176 links |
| 5" Bl. Oak | N 31 ½ W | 152 links |
- 1901 County Road Book, pages 209 and 265, shows road surveyed by John Whilt, County Surveyor, running from NW corner Section 30, 36-29 to North 1/4 corner Section 29, 36-28 on section lines. Gives distance of 80.30 chains to the NE corner Section 27 and 39.78 chains to the North ¼ corner Sec. 25.
- 1925 County Surveyor's Record Book 1, page 135, and Engineer's Notebook No. 46 show survey of SAR No. 3 running from the west to east by Paul Zeese. Ties:
- |           |    |      |
|-----------|----|------|
| TP        | NE | 51.1 |
| 18" Birch | S  | 39.1 |
| 4" Plum   | S  | 53.9 |
- 1940 County Engineer's Notebook No. 134 contains survey of CAR 40 running north from this corner. Corner is shown as a spike in the center of TH 95. Ties:
- |    |    |       |
|----|----|-------|
| FP | SW | 32.2' |
| FP | SE | 27.0' |
- 1942 Minnesota Highway Department notes in Book 89, pages 1-31, call for finding a spike at the intersection of roads east/west/north and fence south. The spike was replaced with a boat spike and 3 reference ties were made.
- 1949 C.H. West, LS, found a boat spike and replaced it with a 8" X 30" concrete monument. Concrete reference monuments were set 80.0 feet SW and 79.9 feet SE. Certificate of Replacing Section Corner was filed. Alignment map for the reconstruction of TH 95 shows corner 16.4 feet south of new centerline.
- 1997 James Nielsen, LS, found a concrete monument at the intersection of a centerline north and 16.2 feet south of a centerline east/west. He filed a Certificate of Location (#261572).
- 2001 Westwood Professional Services, Inc. set a monument at the corner location using ties. County Coordinates Obtained by GPS  
 NAD 83 (1996 Adjustment)  
 N-111146.628  
 E-537510.457
- 2008 The County Surveyor's Office searched and found a PK Nail under the bituminous 16.0± ft. south of centerline of State Highway 95 and in line with the centerline of a road leading to the north. Remains of Nielsen's ties from 1997 were found. The Surveyor accepts Nielsen's method and position and set new ties. Westwood's coordinates from 2001 check using GPS.

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


Northeast Corner of Section 26, Township 36, Range 29, 4th P.M.

STATE OF MINNESOTA, County of Benton

At the corner location shown on the sketch:

- On 07/21/1997 found a concrete monument (down 2.0')  
DATE
- left monument as found,  lowered monument,  removed monument (explain)
- On \_\_\_\_\_ placed a \_\_\_\_\_  
DATE

### SKETCH OF REFERENCE TIES

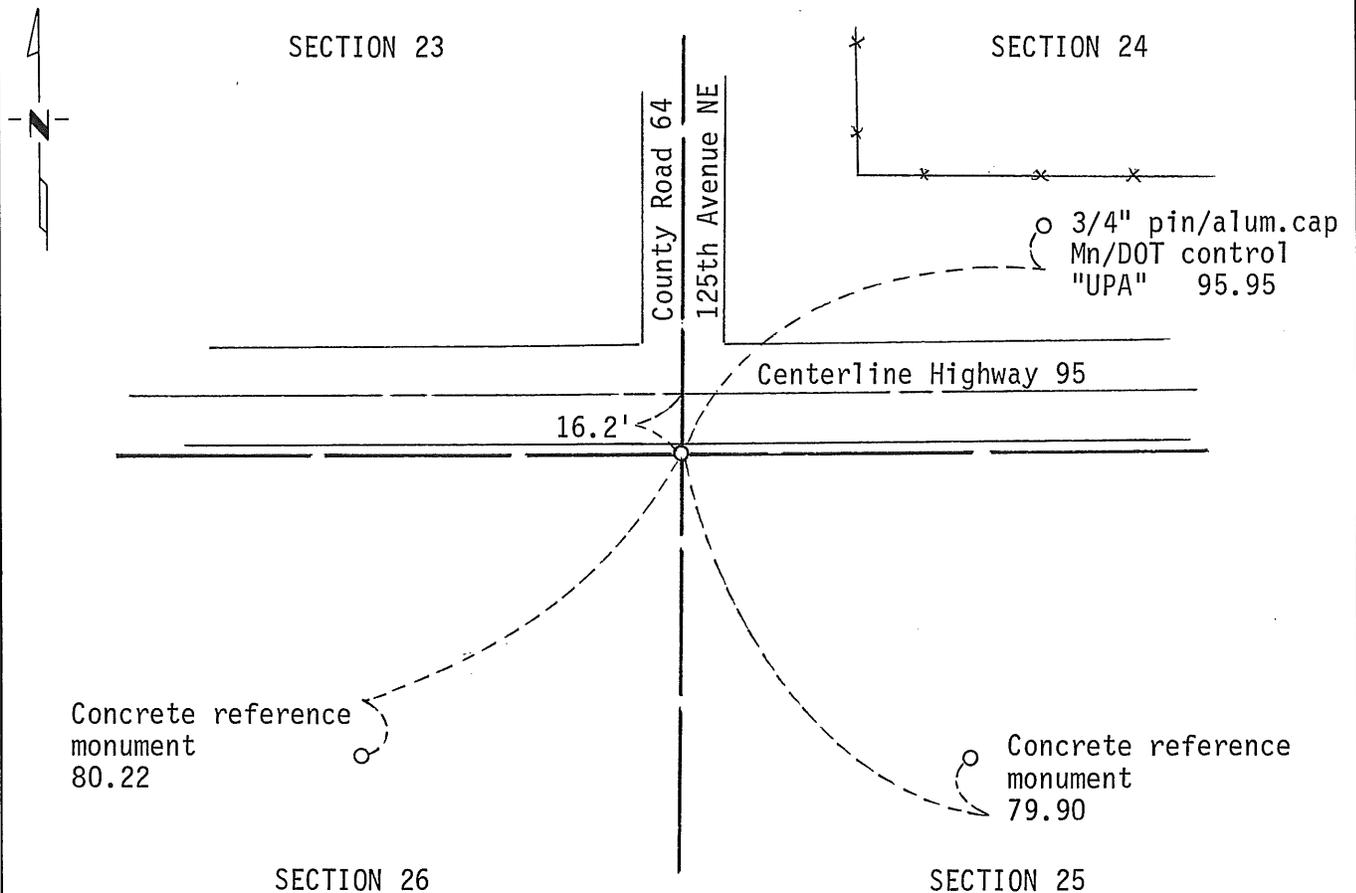

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

James W. Nielson 4/12/99  
SIGNATURE DATE

Registration No. 11865

- Land Surveyor,  Professional Engineer
- County Surveyor,  County Engineer

#### OFFICE OF THE COUNTY RECORDER

County of \_\_\_\_\_

I hereby certify that this document was filed in the Co. Recorders office at \_\_\_\_\_ .M. on the \_\_\_\_\_ day of \_\_\_\_\_ A.D., 19 \_\_\_\_\_

County Recorder \_\_\_\_\_

By \_\_\_\_\_, Deputy

DOCUMENT NO. \_\_\_\_\_

Statement of Evidence:

NORTHEAST CORNER SECTION 26, TOWNSHIP 36 NORTH,  
RANGE 29 WEST, BENTON COUNTY, MINNESOTA

In 1855, the original public land survey was run and a wood post was set to mark the corner.

In 1942, the Minnesota Highway Department notes (Book #89, page 1-32) call for finding a spike at this intersection of roads east-west and north and a fence south. The spike was replaced with a boat spike and three reference ties were made.

In 1944, the Minnesota Highway Department notes (Book #89, page 1-17) call for the boat spike 51.6 feet south of LWP.O.S.T. 379+43.80.

In 1949, TH 95 was reconstructed. The Minnesota Highway Department notes (Book #91 page 27) call for finding the boat spike on December 22, 1948 and making reference ties. Then on November 10, 1949 replacing the boat spike with an eight-inch by 30-inch precast concrete monument for the corner and two concrete monuments for reference marks.

In 1997, the Minnesota Department of Transportation recovered the 1949 concrete monument (down 2 feet) and both concrete referenced monuments.

For details and surveys analysis contact the Minnesota Department of Transportation Surveys Office in Baxter.

261572

OFFICE OF  
BENTON COUNTY RECORDER  
BENTON COUNTY, MN  
CERTIFIED TO BE FILED  
AND/OR RECORDED ON

OCT 6 8 36 AM '99

ALICE C. ENGELMEYER  
COUNTY RECORDER

BY AW DEPUTY