

Certified, Filed and or Recorded on
Nov. 05, 2008 AT 08:21AM

Signed: JN
MARILYN J NOVAK G V I
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


EAST QUARTER Corner of Section 35, Township 37, Range 31
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

On 10-9-08 found a 1/2" SOLID PIN

left monument as found lowered monument removed monument (explain)

On _____ placed an _____

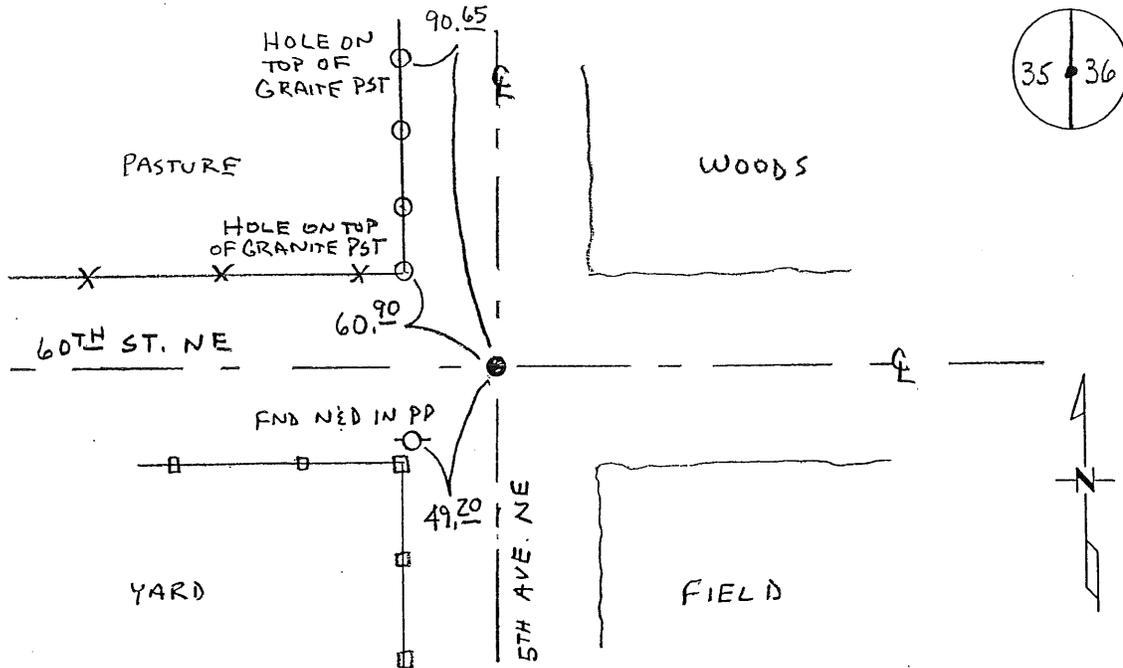

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature Ch. H. [Signature]
Deputy County Surveyor
License No. 43932

Date: 11/3/08

Benton County Surveyor's Office
 Chris Hoglund, Deputy County Surveyor
 Minnesota License No. 43932

Statement of Evidence:

F353

East Quarter Corner of Section 35, Township 37 North, Range 31 West, Watab Township, 4th Principal Meridian, Benton County, Minnesota.

- 1850 Original US General Land Office surveyor, John Ryan, set a wood post at this location and bearing trees were recorded.
- | | | |
|-------------|------------|-----------|
| 6" Blk. Oak | N 84 1/2 W | 65 links |
| 6" Blk. Oak | N 70 1/2 E | 223 links |
- 1982 David Regan, LS 12236, found a RR spike in the centerline of a township road north, County Road 57 east/west and County Road 69 west. He set cast iron monument at the location and filed a Certificate of Location (#163366).
- 1999 Survey information from MN/DOT gives the following coordinates:
 NAD83 (1986 ADJ.)
 N - 134790.718
 E - 473207.036
- 2000 Westwood Professional Services, Inc. found a 1/2" iron pin at the corner location.
- 2002 MN/DOT Right of Way Plat 5-19 shows iron pin over a cast iron monument.
- 2003 Westwood Professional Services, Inc. obtained coordinates to a PK nail.
 County Coordinates Obtained by GPS
 NAD 83 (1996 Adjustment) - DO NOT USE WITHOUT CHECKING
 N- 134791.128
 E - 473206.593
- 2004 Found 1/2 " iron pin and measured 2666.54 feet to the NE corner and 2670.59 feet to the SE corner.
 County Coordinates obtained by GPS to pin.
 NAD 83 (1996 Adjustment)
 N-134791.034
 E-473206.526
- 2008 Westwood Professional Services, Inc. found a 1/2" iron pin at the corner location fitting two of Regan's 1982 ties. Position fits occupation of roads and ~2.3 feet of a lost position. 1/2" iron pin is accepted as marking the obliterated position for this corner. Coordinates obtained by GPS coincide with 2004 position.

283101

OFFICE OF
BENTON COUNTY RECORDER
BENTON COUNTY, MN
CERTIFIED TO BE FILED
AND/OR RECORDED ON

FEB 21 2 55 PM '02


MARILYN J. NOVAK
COUNTY RECORDER
BY Marilyn J. Novak DEPUTY

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

EAST QUARTER Corner of Section 35, Township 37, Range 31
4th Principal Meridian, State of Minnesota, County of BENTON

At the corner location shown on the sketch:

- On 6-26-2000 found a CAST IRON MONUMENT WITH THE TOP BROKEN OFF AND MISSING
DATE
- left monument as found lowered monument removed monument (explain)
- On 6-26-2000 placed a 0.75 BY 12 INCH IRON PIN OVER TOP OF BROKEN MONUMENT
DATE

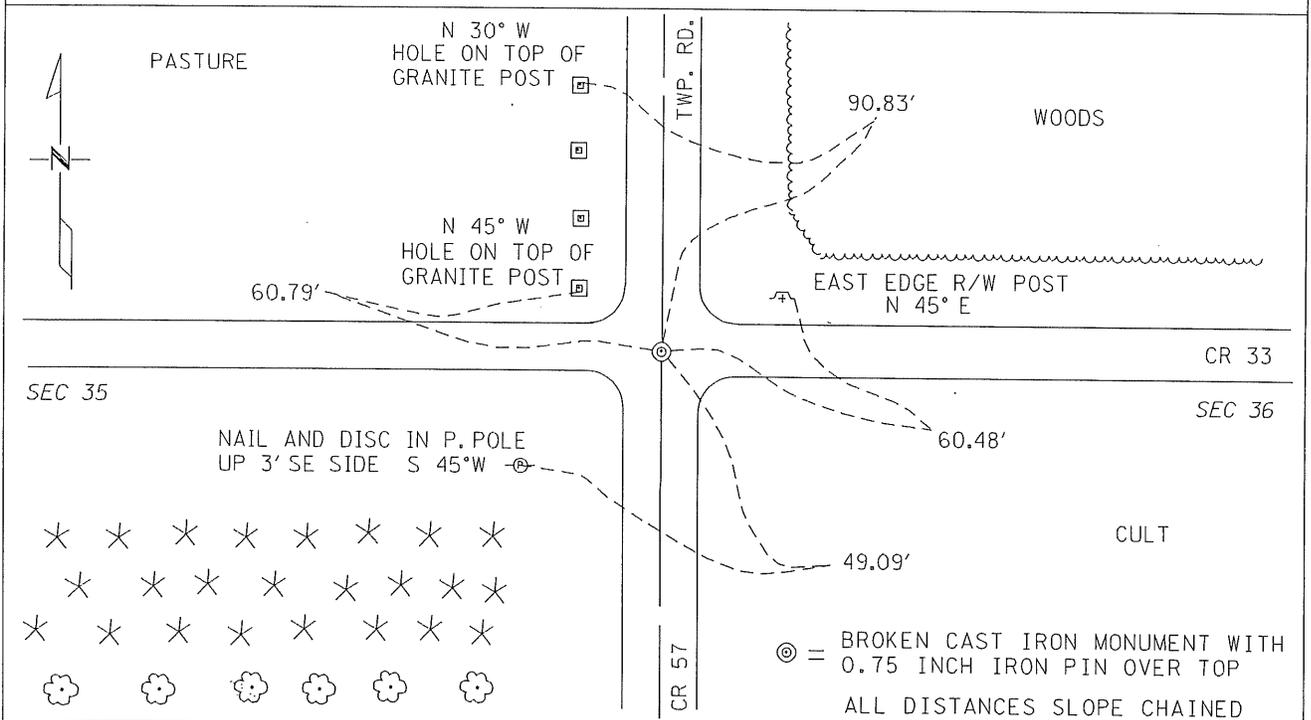

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision.

Signature [Signature] MNDOT Date 1-28-2002 License No. 40343
Title: Land Surveyor Professional Engineer County Surveyor County Engineer

Statement of Evidence: East Quarter Corner Section 35, Township 37 North, Range 31 West, 4th Principal Meridian, Benton County, Minnesota.

The original Public Land Survey was run in 1849 and 1850 by Mr. Theodore Conkey and Mr. John Ryan, and a wood post was used to mark the corner. Bearing Tree ties were established to two Black Oaks.

On August 12th, 1982, Mr. David Regan, Registered Land Surveyor, found a railroad spike at the intersection of roads North, South, East, and West. A Benton County Cast Iron Monument was set, and ties were made, as described in Document Number 163366, on file at The Benton County Recorder's Office.

On June 26th, 2000, the Minnesota Department of Transportation searched the area and recovered a Cast Iron Monument, with the top snapped off, and two of Regan's 1982 ties. A 0.75 inch by 12 inch iron pin was placed over the broken monument, and additional bearing ties were established as described on the front of this document. The Minnesota Department of Transportation accepts this position as the correct location for the corner.

For details and survey analysis, contact the Minnesota Department of Transportation District Surveys Office in Baxter, Minnesota.

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


East Quarter _____ Corner of Section 35, Township 37, Range 31, 4th P.M.

STATE OF MINNESOTA, County of Benton

At the corner location shown on the sketch:

- On 8/12/82 found a railroad spike in center lines of Twp Rd. north,
Co. Rd. #57 east and south and Co. Rd. #69 west
 left monument as found, lowered monument, removed monument (explain)
- On 8/12/82 placed a Benton County cast iron monument
DATE

SKETCH OF REFERENCE TIES

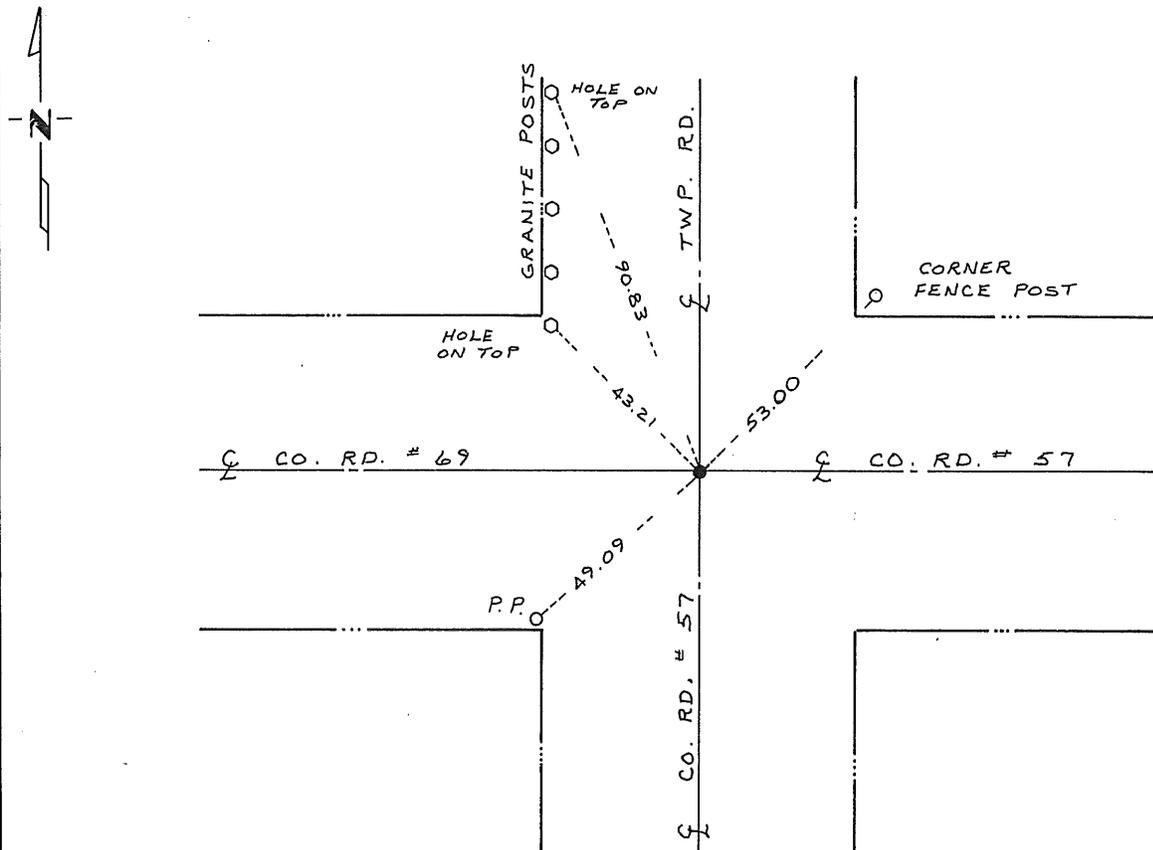

Statement of evidence relative to this corner location is on back of page. **163366**

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

David A. Ryan 9/1/82
SIGNATURE DATE

Registration No. 12736
 Land Surveyor, Professional Engineer
 County Surveyor, County Engineer

County Recorder
 OFFICE OF THE REGISTER OF DEEDS
 County of Benton

I hereby certify that this document was filed in the Reg. of Deeds office at 11 A.M. on the 18th day of October A.D., 1982

County Recorder
 Register of Deeds F.A. Johnson
 By _____, Deputy

DOCUMENT NO. _____