

Certified, Filed and or Recorded on  
Mar. 11, 2009 AT 10:18AM


Signed: [Signature]  
MARILYN J NOVAK G V I  
BENTON COUNTY MINNESOTA  
MARILYN J NOVAK  
COUNTY RECORDER

### CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


NORTHEAST Corner of Section 17, Township 37, Range 31  
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On 12/4/08 found a 1/2" IRON PIPE CAP #42621 UP 0.2'
- left monument as found       lowered monument       removed monument (explain)
- On \_\_\_\_\_ placed an \_\_\_\_\_

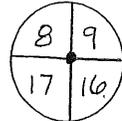

WOODED

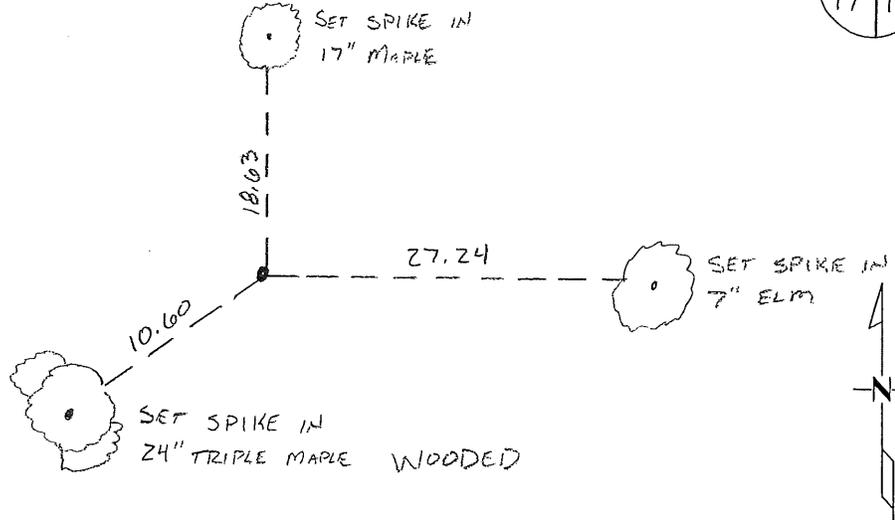

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature [Signature]  
Deputy County Surveyor  
License No. 43932

Date: 3/6/09

Benton County Surveyor's Office  
 Chris Hoglund, Deputy County Surveyor  
 Minnesota License No. 43932

**Statement of Evidence:**

Northeast Corner of Section 17, Township 37 North, Range 31 West, Watab Township,  
 4<sup>th</sup> Principal Meridian, Benton County, Minnesota.

- 1850 Original US General Land Office survey set a wood post at this location and bearing trees were recorded.
- |             |            |           |
|-------------|------------|-----------|
| 12" Bur Oak | S 80 1/2 W | 57 links  |
| 12" Bur Oak | N 57 1/2 E | 107 links |
- 2002 No resurvey information has been found on this corner in the Benton County records.
- 2003 Surveying & Engineering Professionals, Inc reported finding a spike set by William Lunser, LS 9394, marking the corner 2646.35 feet west of the North ¼ corner of Section 16. They set a ½ " iron pipe over the spike.
- 2008 Westwood Professional Services, Inc. found a ½" iron pipe capped 42621 at the corner location. Measured 2646.27 feet to the N1/4 of Section 16 which agrees with SEPI distance. Searched area for any evidence of original bearing trees and nothing found. No evidence of occupation exists in the area. Iron pipe is 6.27 feet long of GLO measurement and fits line well when compared to the N1/4, NE corner of Section 16 and the witness corner to the MC on the north line of Section 17. After analysis of this corner, I believe we are using the best available evidence and have no basis to dispute its location. ½" iron pipe capped 42621 is accepted as marking the obliterated position for this corner.  
 County Coordinates Obtained by GPS  
 NAD 83 (1996 Adjustment)  
 N-153456.153  
 E-457484.378